

# The Challenge Machinery Company

## PRODUCT SAFETY BULLETIN

**Date:** November 11, 2014

**Product:** 370 X cutter


**Serial Number Ranges:** 98001 through 99999,  
00001 through 14999

**Description:** Notch in Clevis may not be deep enough

### Clevis Inspection Procedure For The Challenge 370 X Cutter

Remove the cover on the right hand side of the machine to show the clevis and knife bar connection.

This inspection should be done when the knife is in the up position and the power to the machine turned OFF. You should see a gap between the notch cut in the knife pull down clevis and the knife bar casting. See photo, in this photo there is no gap. If your machine does not have a gap at this location contact Challenge Machinery for a replacement clevis.

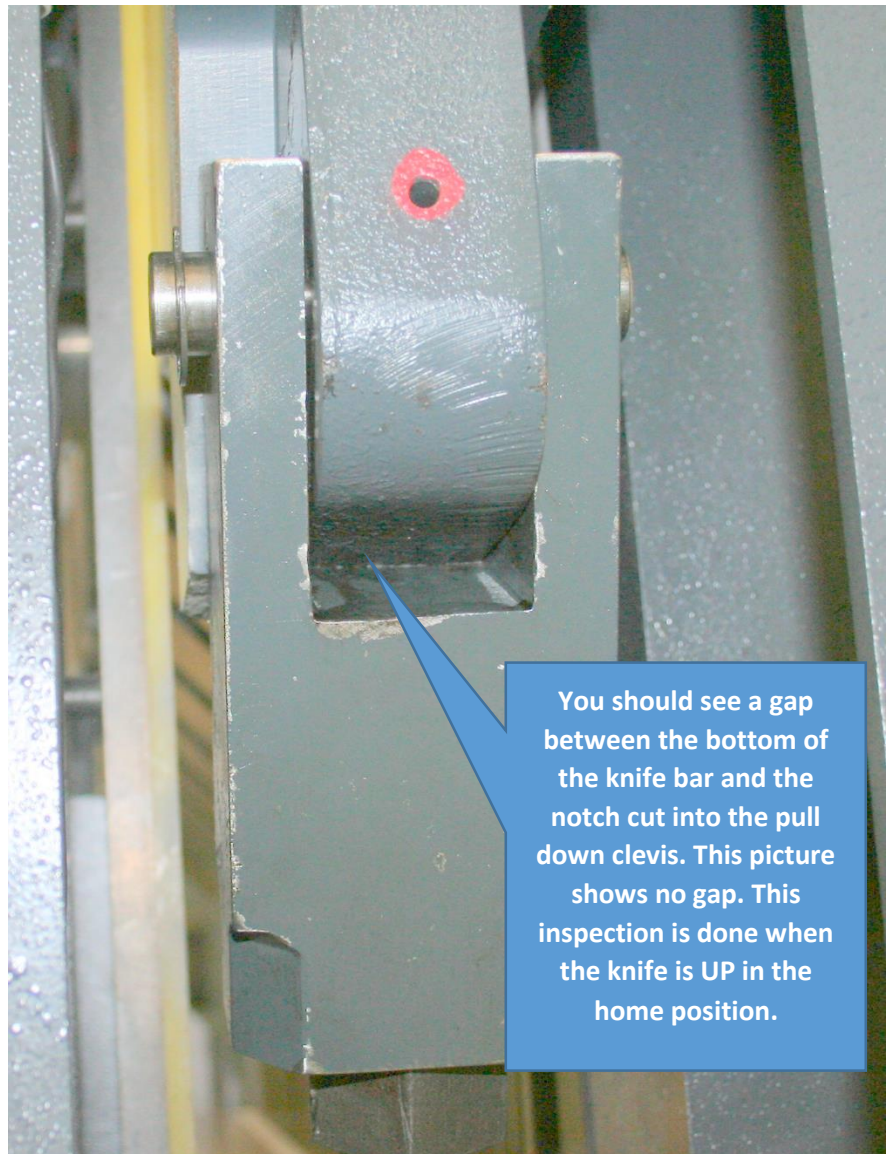

You should see a gap between the bottom of the knife bar and the notch cut into the pull down clevis. This picture shows no gap. This inspection is done when the knife is UP in the home position.